



Wipaire Worldwide
Anywhere, Anytime

SERVICE LETTER: #56

DATE: November 13, 2002

TITLE: Main Landing Gear Shock Strut Replacement

EFFECTIVITY-FLOAT S/N's: 3000A S/N's: 30094A & DN
3450A S/N's: 34084A & DN

COMPLIANCE: a) Within 10 days or 5 hrs. install shock strut retaining pin, retainer and cotter pin per service kit #38.
b) Within 2 years or at next annual inspection or major disassembly of the shock strut assembly install service kit #39.

BACKGROUND INFORMATION:

The cotter pins in the retaining pin at the top of the shock strut may have been damaged, and come out, and this will result in the retaining pin working its way out and shock strut coming apart.

This may be a result of taxing on rough taxiways, landing on rough landing strips, hard landings or corrosion.

METHOD OF COMPLIANCE: Install Service Kits (a) #38 or (b) #39.

SHOP HOURS REQUIRED: a) 1 Hrs.
b) 4 Hrs.

WARRANTY: Kit #38, Parts only for 18 months past the original issuance of this service letter.
Kit #39, Parts only for 18 months past the original issuance of this service letter.